

RefPlus® recommends the inspection of all axial fan motors installed on unit models starting with the following first two letters:

AB, CB, EG, FB, GB, ON, TB & TV

12 MONTH LIMITED WARRANTY EXTENSION ON SERVICED FAN UNITS

RefPlus will grant a 12 month limited warranty extension for each of the serviced fan units, as described below. To obtain the warranty extension, please fill out the attached form.

We were recently advised by Ziehl-Abegg that the axial fan(s) installed on the above listed models may be fitted with a drain plug and that this plug, if existent, must be removed to allow proper water drainage.

Follow these steps carefully to remove the plug.




WARNING! Before proceeding, always check to make sure main power to systems is OFF. Electrical shock can cause personal injury or death.

HORIZONTAL FLAT COIL MODELS

On these models, the drain plug is accessible through small doors located on each side of the unit.

1. Remove the door panel by removing the 4 bolts.

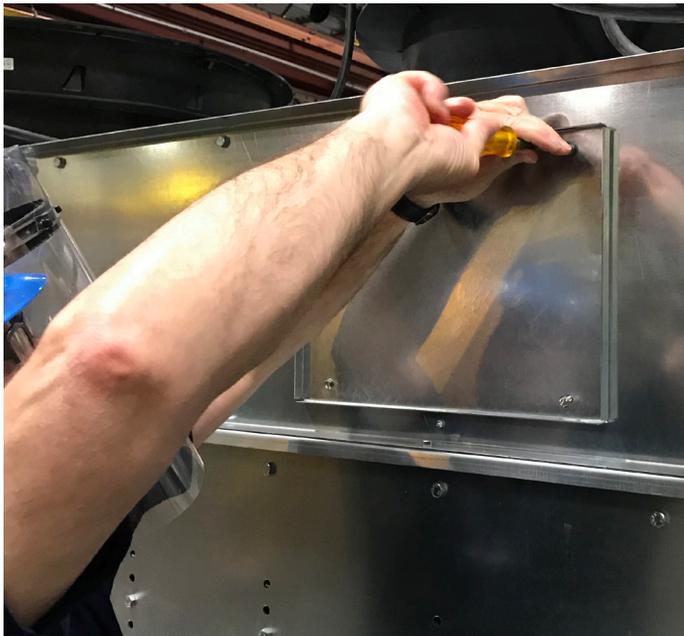

2. Once the panel removed, you will have access to the fan hub, as shown. On the hub, you will find a small screw that acts as a plug. Use a TX-20 screwdriver to permanently remove this screw.



3. Put the door panel back in place and repeat the same procedure on all fans of the unit.

V OR W-SHAPE COIL MODELS

On these particular models, the plug is accessible from the top of the unit.

1. Remove the fan guard by first removing the 4 bolts with a TX-30 screwdriver.



2. Once the guard is removed, you will have access to the fan hub. The drain plug screw is located on the back of the hub. You will find it by rotating the hub with one hand and groping with the other.



3. When you have identified the screw, remove it permanently with a TX-20 screwdriver.



4. Put the fan guard back in place and repeat the same procedure on all fans of the unit.

For any questions regarding this procedure, please contact RefPlus' technical service at service@refplus.com