

**FUJITSU GENERAL AMERICA, INC**

353 Route West. Fairfield, NJ 07004

Ph: 973-575-0381 Fx: 973-836-0449

Em: ServiceHVAC@fujitsugeneral.com

**SERVICE BULLETIN**

Number: 0009

Date: 10.27.09 Rev2

Type: FGAI

**PROBLEM**

Poor connections of wire harness in the EEV cover.

**SOLUTION**

Replace with new Electronic Expansion Valve (EEV)

MODEL : AOU18/24/36RLX,  
AOU24/36RML, AOU24CL/RL/RLQ


Production serial number: See below

If you are experiencing erratic cooling or heating operation on a system that is properly charged consider replacing the expansion valves.

Cause of failure:

The mixture of epoxy and stiffening materials in the EEV cover, which fix the connector and wires at the FUJIKOUKI Electronic Expansion Valve, did not have the correct mix ratio. Because the ratio was incorrect, depending on the temperature, the wires would separate internally from the coil preventing the EEV from opening or closing.

The models affected have serial numbers below the ones on this table and should be replaced. Contact your local distributor to order the EEV.

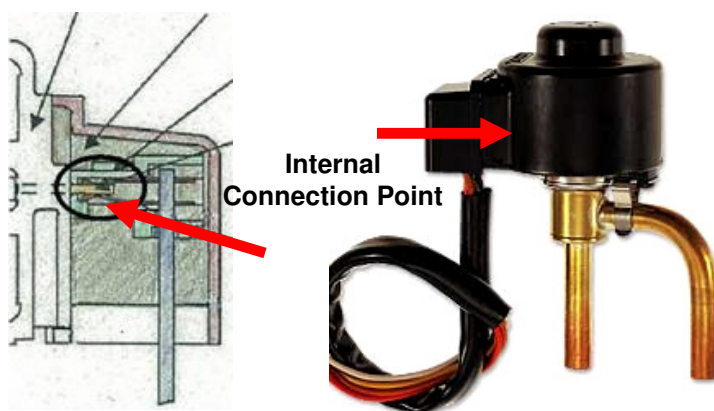

Model	Serial Number
AOU18RLX	CQN000001- CQN003971
AOU24RLX	CTN000001- CTN003480
AOU36RLX	CWN000001- CWN003801
AOU24RML	All
AOU36RML	All
AOU24RML1	DXN000001- DXN010746
AOU36RML1	DYN000001- DYN007843
AOU24CL	DDN000001- DDN019837
AOU24RL	All
AOU24RLQ	All