

**ENERGY APPORTIONMENT TOUCH PANEL CONTROLLER UTY- DTGYZ1
SOFTWARE UPDATE L002****Source for this Bulletin**

Japan Service Bulletin VRF-0144 issued August 22, 2016


Outline

Touch Panel Controller (TPC) may produce Error E17 that is due to the following combined conditions:

Conditions

1. Electricity Charge Apportionment (UTY-PTGXA) is installed.
2. A Single Split System Converter is connected to the same VRF network.

UTY-DTGYZ1 + UTY-PTGXA
UTY-DTGGZ1

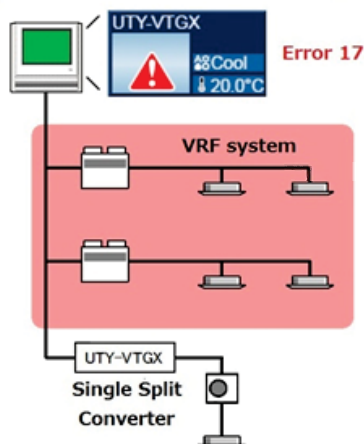**Example of Error 17 occur when using a single split system on VRF Network.**

Error should not be displayed, because the Electricity Charge Apportionment (ECA) function is not available for single split systems.

* The calculation result of the ECA is not affected by the Error.

* All of the controlling functions on the TPC are not affected by the Error.



Applicable serial number

UTY-DTGYZ1: 2000001 -- 2000292


Updating the software

1. Download the file "gktkp_010002.rpm" from the Fujitsu Portal >> Downloads >> Touch Panel Controller with Internet Optional Software >>Energy Apportionment SOFTWARE UPDATE L002
2. Copy the file to a USB memory stick.
3. Plug the USB memory stick into the TPC while it is powered ON.
4. The update to the TPC will start automatically.

5. Press the OK button to proceed.

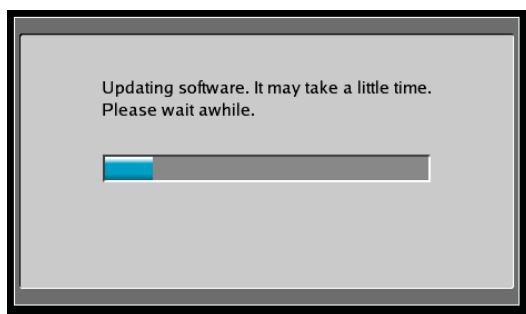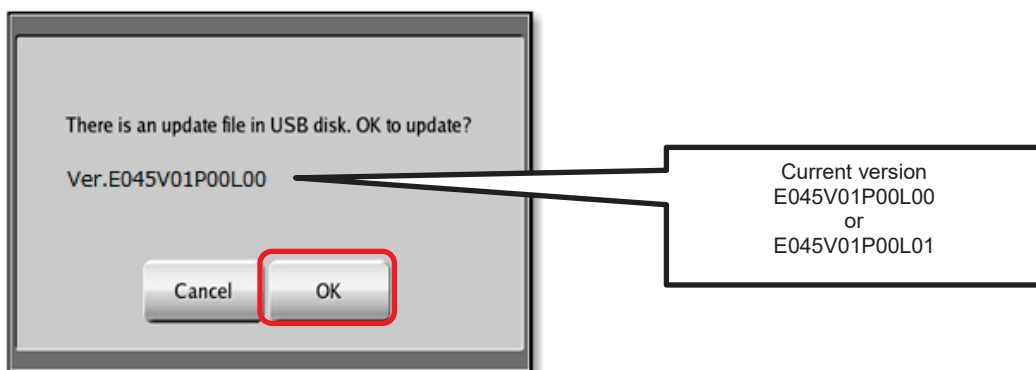

6. When "Updating, software is successful" message appears, press the CLOSE button to finish the update. The new software version shall be: E045V01P00L02

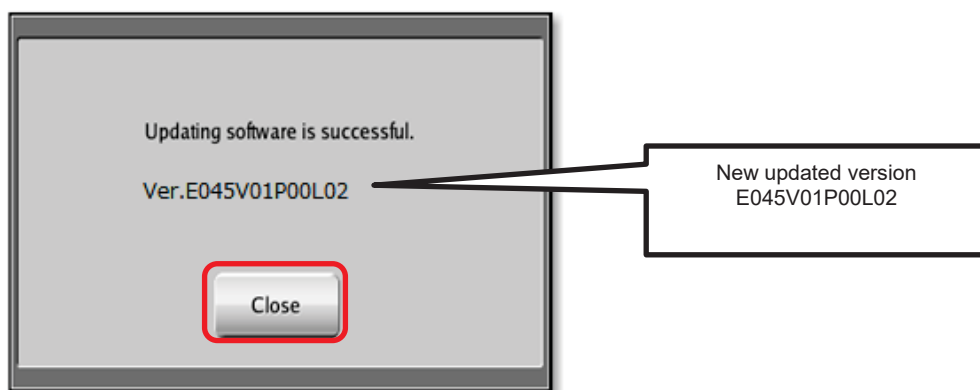

7. Disconnect the USB memory stick after powering off the TPC.