FUJITSU GENERAL AMERICA, INC 353 Route West. Fairfield, NJ 07004 Ph: 973-575-0381 Fx: 973-836-0449 Em: ServiceHVAC@fujitsugeneral.com	SERVICE BULLETIN Number: 0025 Date: 12/3/2012 TYPE: Field

PROBLEM:	**Evaporator intake grille may not completely close.**
SOLUTION:	Add an adhesive tape to make intake grille clip fit tighter making sure panel snaps completely closed.

MODEL : **ASU- 9-12-15RLS2**	PART NUMBER: **KCLIPRLS2**

TURN OFF MAIN POWER AND WAIT APPROXIMATELY 60 SECONDS BEFORE STARTING WORK.

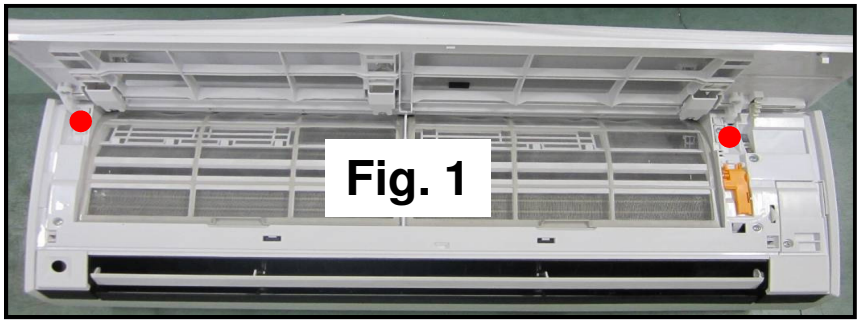

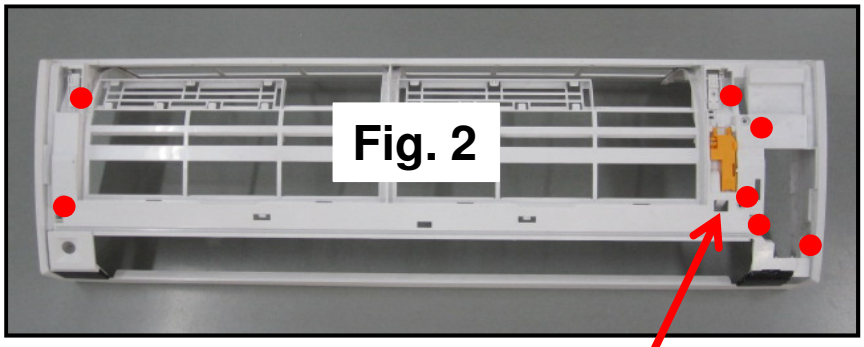

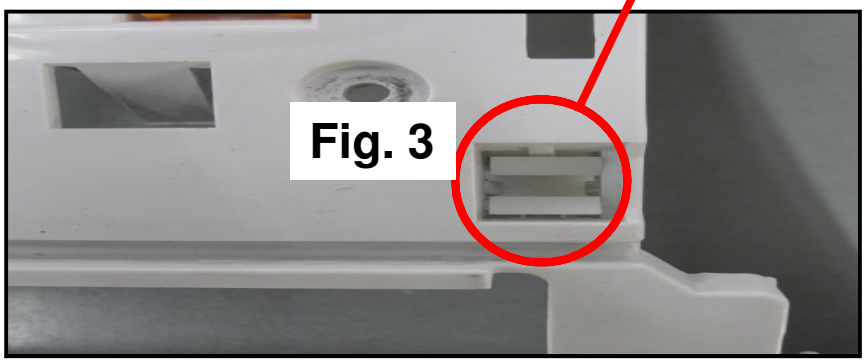

Fig. 1

1. Remove the Intake grille.

Fig. 2

2. The **red** circles indicate the screws that need to be removed to dismount the evaporator cover.

3. Remove the front panel cover screws. Proceed to remove entire cover from evaporator.

Fig. 3

4. This (1) clip needs to be removed, located on the right side (front) cover.

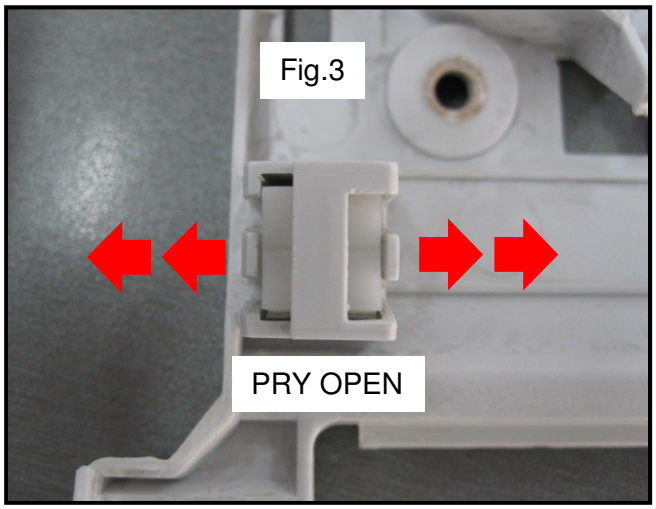

Turn to the back of the evaporator cover and find where the clip is inserted (figure 3). ***Carefully pry open*** the 2 snap arms outward (follow the direction of the **red** arrows) then push clip out.

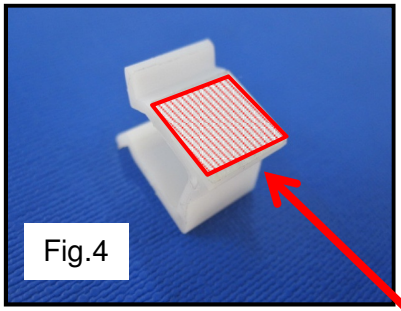

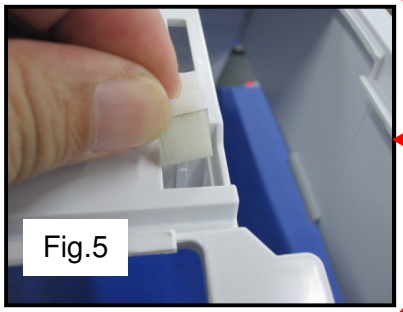

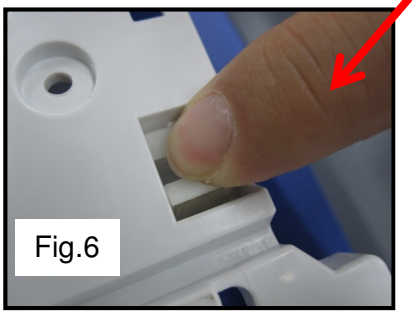

Attach the adhesive modification sheet in (fig 4) to either side of the clip.

Reinserted clip back into its locations with the adhesive sheet facing downward. (fig 5)

Make sure the clip is completely snapped-in by listening for the snapping sounds. (fig 6)

Reassemble the front cover and grille.
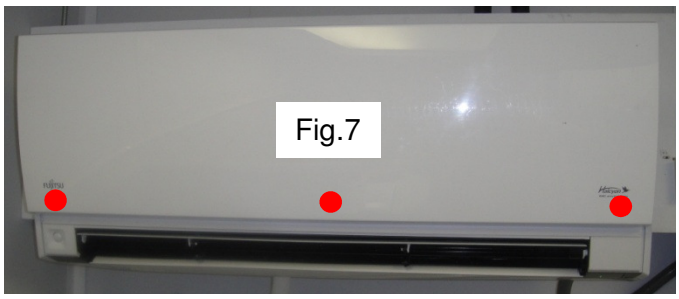
Close the intake grille and listen for the snapping sound to confirm that it is snapped-in along the 3 locations of the front cover as shown in Fig 7. The **red** circles indicate where the front cover should be snapped into intake grille.